



VEHICLE INSPECTION REPORT

Inspector	Provided by	Date
H. Filali	Carspector GmbH	08.09.2026

The vehicle inspection was performed by the above-mentioned inspector. This condition report was generated and provided by Carspector based on the inspection data collected during the inspection.

INSPECTION CONDITIONS

Criteria	Value
Weather conditions	Partly cloudy
Lighting conditions	Bright (daylight)
Vehicle clean?	Yes
Vehicle accessible?	Yes

VEHICLE DATA

Parameter	Value	Parameter	Value
Manufacturer	Audi	VIN	WAUZZZF85RN007697
Model	A8	Type	Sedan
Transmission	Automatic	First Registration	04.01.2024
Fuel	Diesel	Color	Gray
Engine	2.967 cm ³	No. Doors	4/5
Power	210 kW (286 HP)	Next HU	—
Displayed Mileage	54.699 km	Emission class	Euro 6



VEHICLE DOCUMENTS

Document	Value / Details
Approvals	—
Registration certificate	Not available / not provided
Vehicle title	Not available / not provided
Owner's manual	Available
Inspection report (HU/AU)	Not available / not provided
Service book (type)	Not available / not provided
Service book maintained?	—



TIRES

Tire set 1

Pos.	Manufacturer	Type	Size	Tread / DOT
FL	Pirelli	Summer	265 / 35 R21	4,0 mm / 1524
FR	Pirelli	Summer	265 / 35 R21	4,0 mm / 1524
RL	Pirelli	Summer	265 / 35 R21	3,0 mm / 4623
RR	Pirelli	Summer	265 / 35 R21	3,0 mm / 4623

Tire set 2

Pos.	Manufacturer	Type	Size	Tread / DOT
FL	—	—	—	—
FR	—	—	—	—
RL	—	—	—	—
RR	—	—	—	—

Extra

Extra	Tire repair kit present
Expiry date	12/2028



PAINT THICKNESS & CONDITION

Component	Paint layer thickness (µm)	Repainted?	Damages / Findings
Hood	🚩 368 µm	Yes	None
Fender FL	110 µm	No	None
Fender FR	110 µm	No	None
Door FL	110 µm	No	None
Door RL	102 µm	No	None
Door FR	115 µm	No	None
Door RR	100 µm	No	🚩 Scratch
Sidewall RL	110 µm	No	None
Sidewall RR	105 µm	No	🚩 Scratch
Roof	115 µm	No	None
Tailgate	105 µm	No	None
Comment	Further signs of wear present.		

BODYWORK

Component	Condition	Damages / Findings
Front bumper	Damaged	🚩 Stone chip
Rear bumper	OK	None
Grill	OK	None
Sill left	OK	None
Sill right	Damaged	🚩 Scratch
Panel gaps	OK	None



LIGHTING

Component	Function	Damages / Findings
Headlights	OK	None
Rear lights	OK	None
Brake light	OK	None
Reverse light	OK	None
Indicators	OK	None
Hazard warning lights	OK	None
Fog lights	OK	None
Low beam	OK	None
Interior lighting	OK	None
Daytime running light	OK	None



EXTERIOR CONDITION

Body attachments & exterior components

Component	Condition	Damages / Findings
Windshield	OK	None
Window glazing	OK	None
Wipers	OK	None
Seals	OK	None
Central locking	OK	None
Attachments	OK	None
Exterior mirrors	OK	None

Rims

Position	Condition	Damages / Findings
Rim FL	OK	None
Rim FR	OK	None
Rim RL	OK	None
Rim RR	OK	None



MECHANICS & UNDERBODY

Component	Condition	Damages / Findings
Suspension	OK	None
Shock absorbers	OK	None
Springs	OK	None
Brake discs	Damaged	⚠ Other: Close to wear limit
Brake pads	OK	None
Exhaust system	OK	None
Engine oil tightness	OK	None
Gearbox oil tightness	OK	None



TECHNOLOGY

Parameter	Value
Engine oil	OK
Brake fluid	OK
Coolant	OK
Engine bay (general)	Clean
Comment	The seller didn't provide any information regarding service history.

SERVICE / MAINTENANCE

Next inspection	-
Next oil change	-

TEST RUN / TEST DRIVE

Test run / drive performed?	Yes	
Checkpoint	Status	Finding / Note
Starter	OK	None
Clutch	Not present	—
Engine run	OK	None
Unusual noises	OK	None
Timing chain/belt	OK	None



INTERIOR

Component	Condition	Damages / Findings
Seat belts	OK	None
Steering wheel	Damaged / faulty	⚠ Other: Signs of wear
Dashboard	Damaged / faulty	⚠ Scratch
Air conditioning	OK	None
Heating / ventilation	OK	None
Sunroof / convertible top	OK	None
Controls	OK	None
Window lifters	OK	None
Rear-view mirror	OK	None
Seats	Damaged / faulty	⚠ Signs of wear
Glove box	OK	None
Radio	OK	None
Floor	OK	None
Paneling	OK	None
Headliner	OK	None
Horn	OK	None
Odor	OK / neutral	
Comment	Further signs of wear present.	



OTHER

Topic	Description / Details
Errors in Instrument Cluster	Tire pressure monitoring system (TPMS)
Errors in Diagnostic Tool	B130474: Front Left Seat Belt Pretensioner Control Unit - Actuator Deviation
Accident Damage	Present & repaired: Hood repainted

PHOTO DOCUMENTATION

Document type	Link
Photo documentation	18596e2b-3ab1-4c3e-85af-9ef59e656c5d.pdf

Click the photo documentation link to open it.

ADDITIONAL DOCUMENTS

No documents available.

Note: This condition report is based on a visual and functional inspection at the time of assessment. Hidden or non-detectable defects cannot be ruled out. This report does not constitute any guarantee or assumption of liability.

Photo Documentation

Audi A8 • Order number: 26091407 • 46 photos



Photo 1 : Front View



Photo 2 : Rear View



Photo 3 : Left Side



Photo 4 : Right Side



Photo 5 : Front Left (Diag.)



Photo 6 : Front Right (Diag.)



Photo 7 : Rear Left (Diag.)



Photo 8 : Rear Right (Diag.)



Photo 9 : Roof



Photo 10 : Underbody



Photo 11 : Cockpit / Dashboard



Photo 12 : Driver Seat



Photo 13 : Passenger Seat



Photo 14 : Rear Seat Left



Photo 15 : Rear Seat Right



Photo 16 : Trunk / Boot



Photo 17 : Steering Wheel



Photo 18 : Gearshift / Transmission



Photo 19 : Headliner



Photo 20 : Footwell



Photo 21 : Tyre Front Left



Photo 22 : Tyre Front Right



Photo 23 : Tyre Rear Left



Photo 24 : Tyre Rear Right



Photo 25 : VIN / Chassis Number



Photo 26 : Odometer / Mileage



Photo 27 : Engine Bay



Photo 28 : Front Bumper - Stone Chip



Photo 29 : Front Bumper - Stone Chip



Photo 30 : Right Sill - Scratch



Photo 31 : Right Sill - Scratch



Photo 32 : Rear Right Quarter Panel - Scratch



Photo 33 : Rear Right Door - Scratch



Photo 34 : Brake Discs - Close to wear limit



Photo 35 : Brake Discs - Close to wear limit



Photo 36 : Dashboard - Scratch



Photo 37 : Steering Wheel - Abrasion / Wear

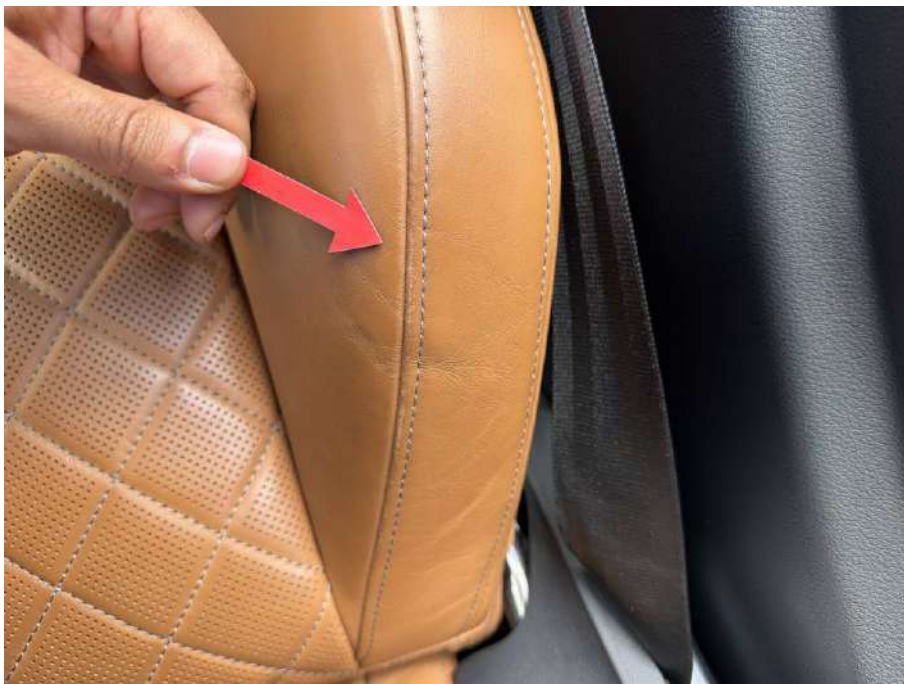


Photo 38 : Seats - Signs of Wear



Photo 39



Photo 40



Photo 41

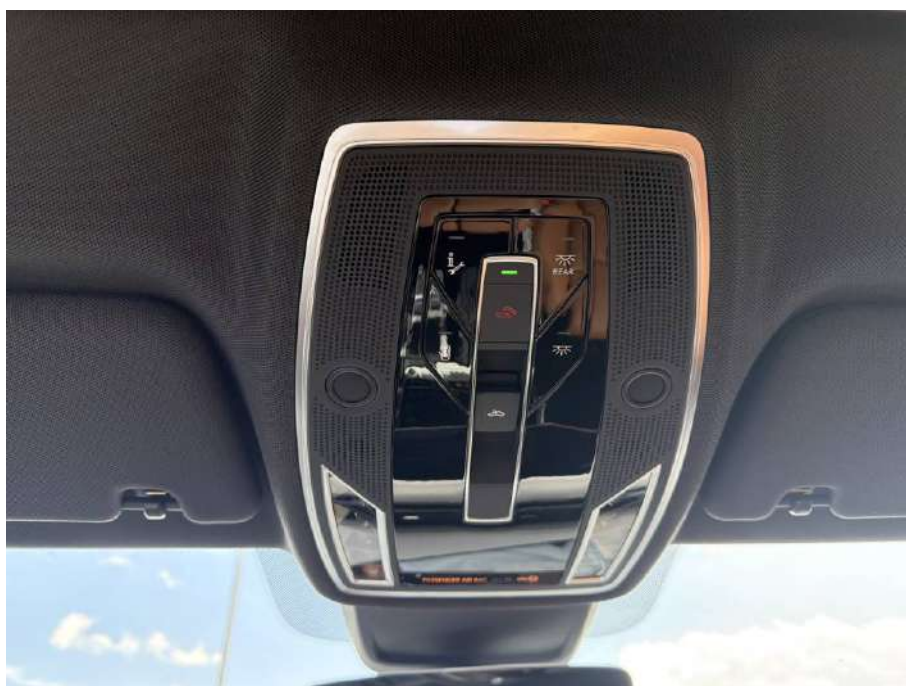


Photo 42



Photo 43



Photo 44

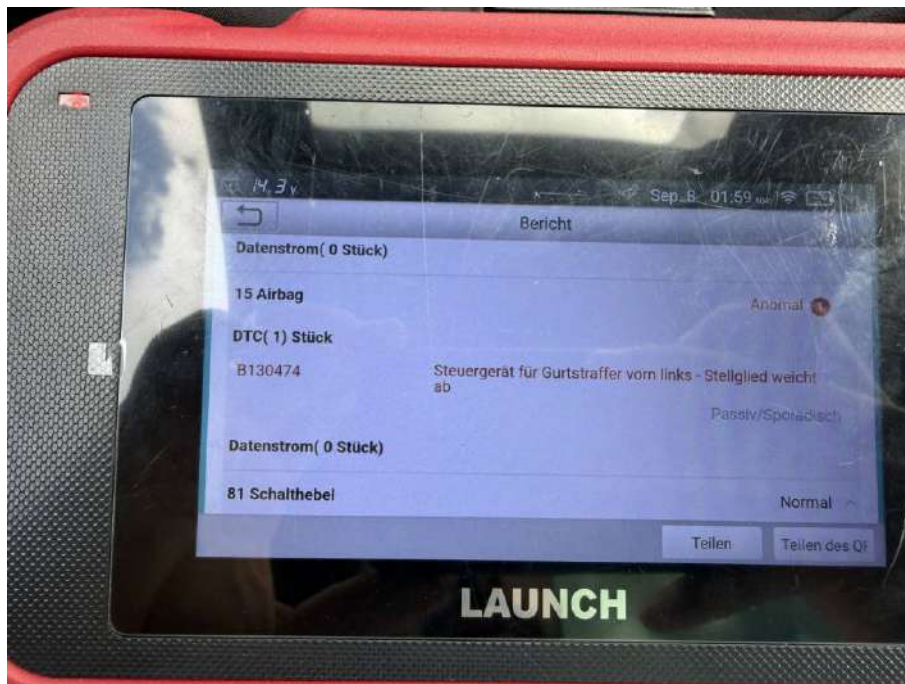


Photo 45

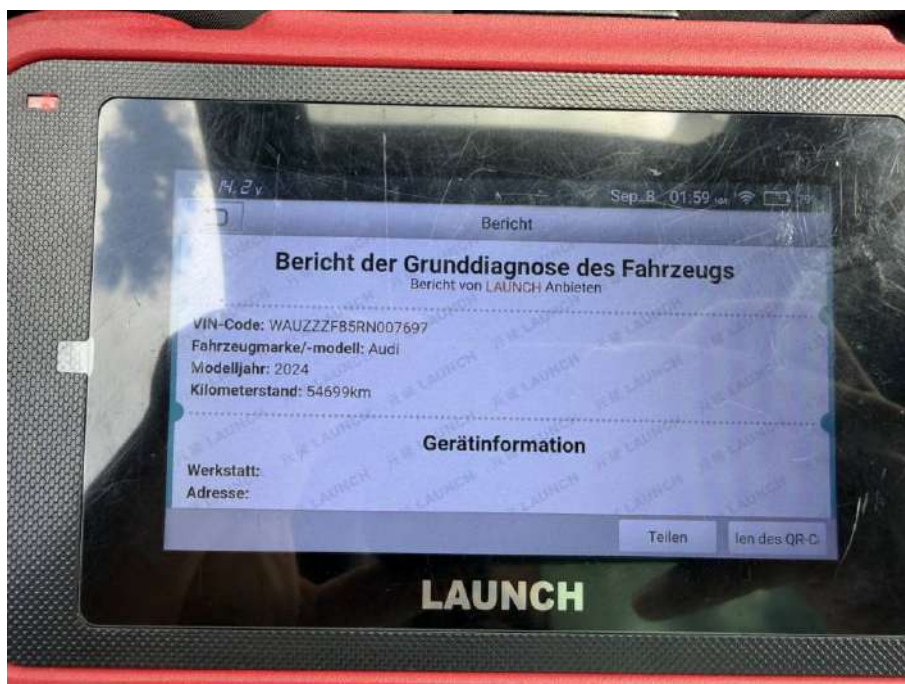


Photo 46